IDX Series Install Guide

Included Items:

- IDX Series Camera x 1
- Mounting Plate x 1 4x20mm Screws x 4
- Test Monitor BNC Lead x 1

• Instructions x 1

Required Items:


• Phillips Head Screwdriver or Drill with Phillips Head Bit

Optional Items:

• CE-REMOTE (OSD Remote Control)

1. INSTALL MOUNTING PLATE


Secure the Mounting Plate to a compatible conduit box (Single Gang, Double Gang, 3-1/4" & 3-1/2", or 4" Oct/Rd) using the screws that came with the conduit box, or mount to a solid surface using the 4 screws included with this camera.

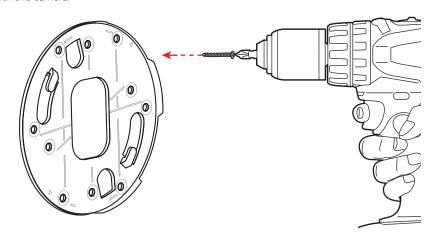

NOTE: It is recommend to use drywall anchors if mounting to drywall. Drywall anchors not included.


3. CONNECT CABLES


Make connections to the BNC cable and the power connection. Feed any cable slack into the mounting surface. A green LED (near the OSD Joystick and DIN Connection Port) will light up on the circuit board when the camera is receiving power. To ensure quality operation, verify proper BNC and power termination, along with proper voltage at camera.

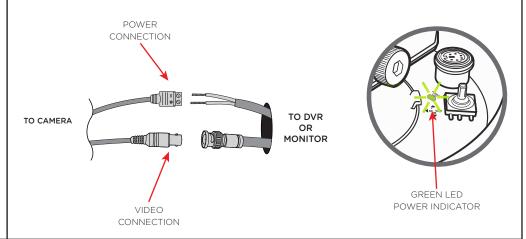

2. REMOVE DOME COVER


Hold the dome cover with one hand while gripping the finger grip tabs on the bottom of the camera base. Turn the finger grip tabs (camera base) counter-clockwise to separate it from the dome cover.

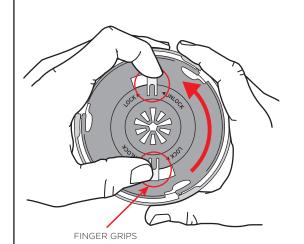


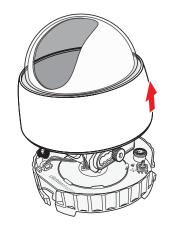

4. ATTACH CAMERA TO MOUNTING PLATE

Attach the camera to the mounting plate by aligning the hooks on the mounting plate to the tabs on the camera base. Twist the camera base clockwise to lock it in place.

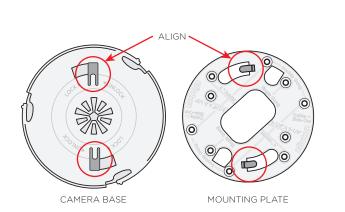


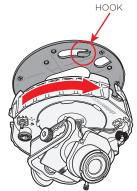

5. CAMERA ANGLE ADJUSTMENT


Adjust the angle of the camera as necessary.

- **A. Lens Rotation:** Rotate the U-Bracket on the gimbal to adjust.
- **B.** Lens Angle: Loosen thumb screws on each side to adjust the tilt of the lens.
- C. Camera Plate Rotation: Pinch the gimbal U-Bracket and rotate the camera assembly on the base.

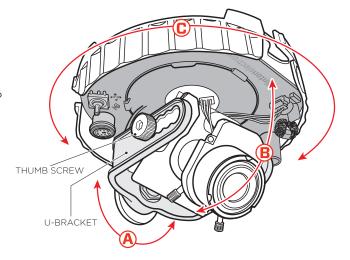


7. TEST MONITOR / OSD CONTROL

To test the camera with a test monitor use either the supplied Test Monitor BNC Lead or optional CE-REMOTE. The Test Monitor BNC Lead plugs into the small, 2 PIN connector (marked CN2) next to the wide 12 wire connection on the circuit board. The CE-REMOTE plugs into the DIN Port. OSD Adjustment can be made by using the OSD Joystick or the optional CE-REMOTE. Refer to OSD Manual for detailed instructions on adjusting camera settings.

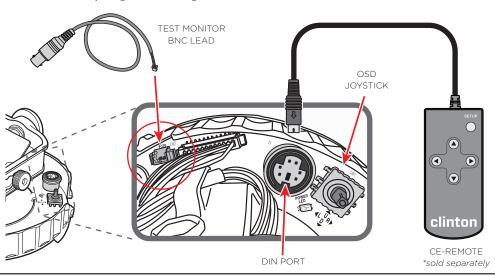

6. ZOOM / FOCUS ADJUSTMENT

Loosen the appropriate adjustment lever by turning counter-clockwise. To widen the viewing angle, rotate the Zoom lever to the Left. To narrow the viewing angle rotate the ZOOM lever to the Right. Rotate the Focus lever Left or Right to focus the lens.

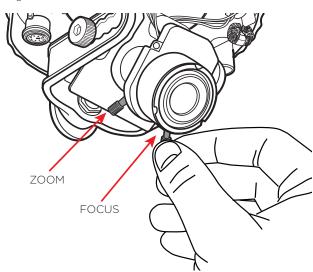

After zoom / focus adjustments have been made, tighten the adjustment levers to lock the adjustments.

8. REPLACE DOME COVER

Carefully replace the dome cover onto the camera assembly by twisting the dome cover clockwise to lock into place. For standard/non-IR cameras with a dome mask, it may be necessary to rotate the clear dome slightly to align the cut out in the mask with the lens.

